

COPYRIGHT NOTICE

This geotechnical log and its associated data (the Document) is licensed by the Queensland Department of Transport and Main Roads under the [Creative Commons Attribution 4.0 Licence](#) (CC BY 4.0). When reusing the Document, in whole or in part, please attribute the Department and author as follows: "(c) *State of Queensland (Department of Transport and Main Roads) 2026, licensed under the CC BY 4.0 Licence, prepared by Insitu Geotech Services*". This licence does not apply to logos or trademarks.

LIMITATION OF LIABILITY

The CC BY 4.0 Licence contains a comprehensive Disclaimer of Warranties and Limitation of Liability. In addition, please note that this Document was prepared for Departmental use only. Reuse of the Document by anyone for any other purpose could result in error and/or loss. You should obtain professional advice before making decisions based on the contents of the Document.

When reproducing any part of this Document, you must also reproduce this limitation of liability notice in addition to the italicised attribution statement above.


Retrieved from the Queensland Geotechnical Database <http://qgd.org.au/>

CONE PENETROMETER TEST RESULT

TMR
Centenary Bridge Upgrade
Jindalee QLD

CPT7

RL: not recoded on peg

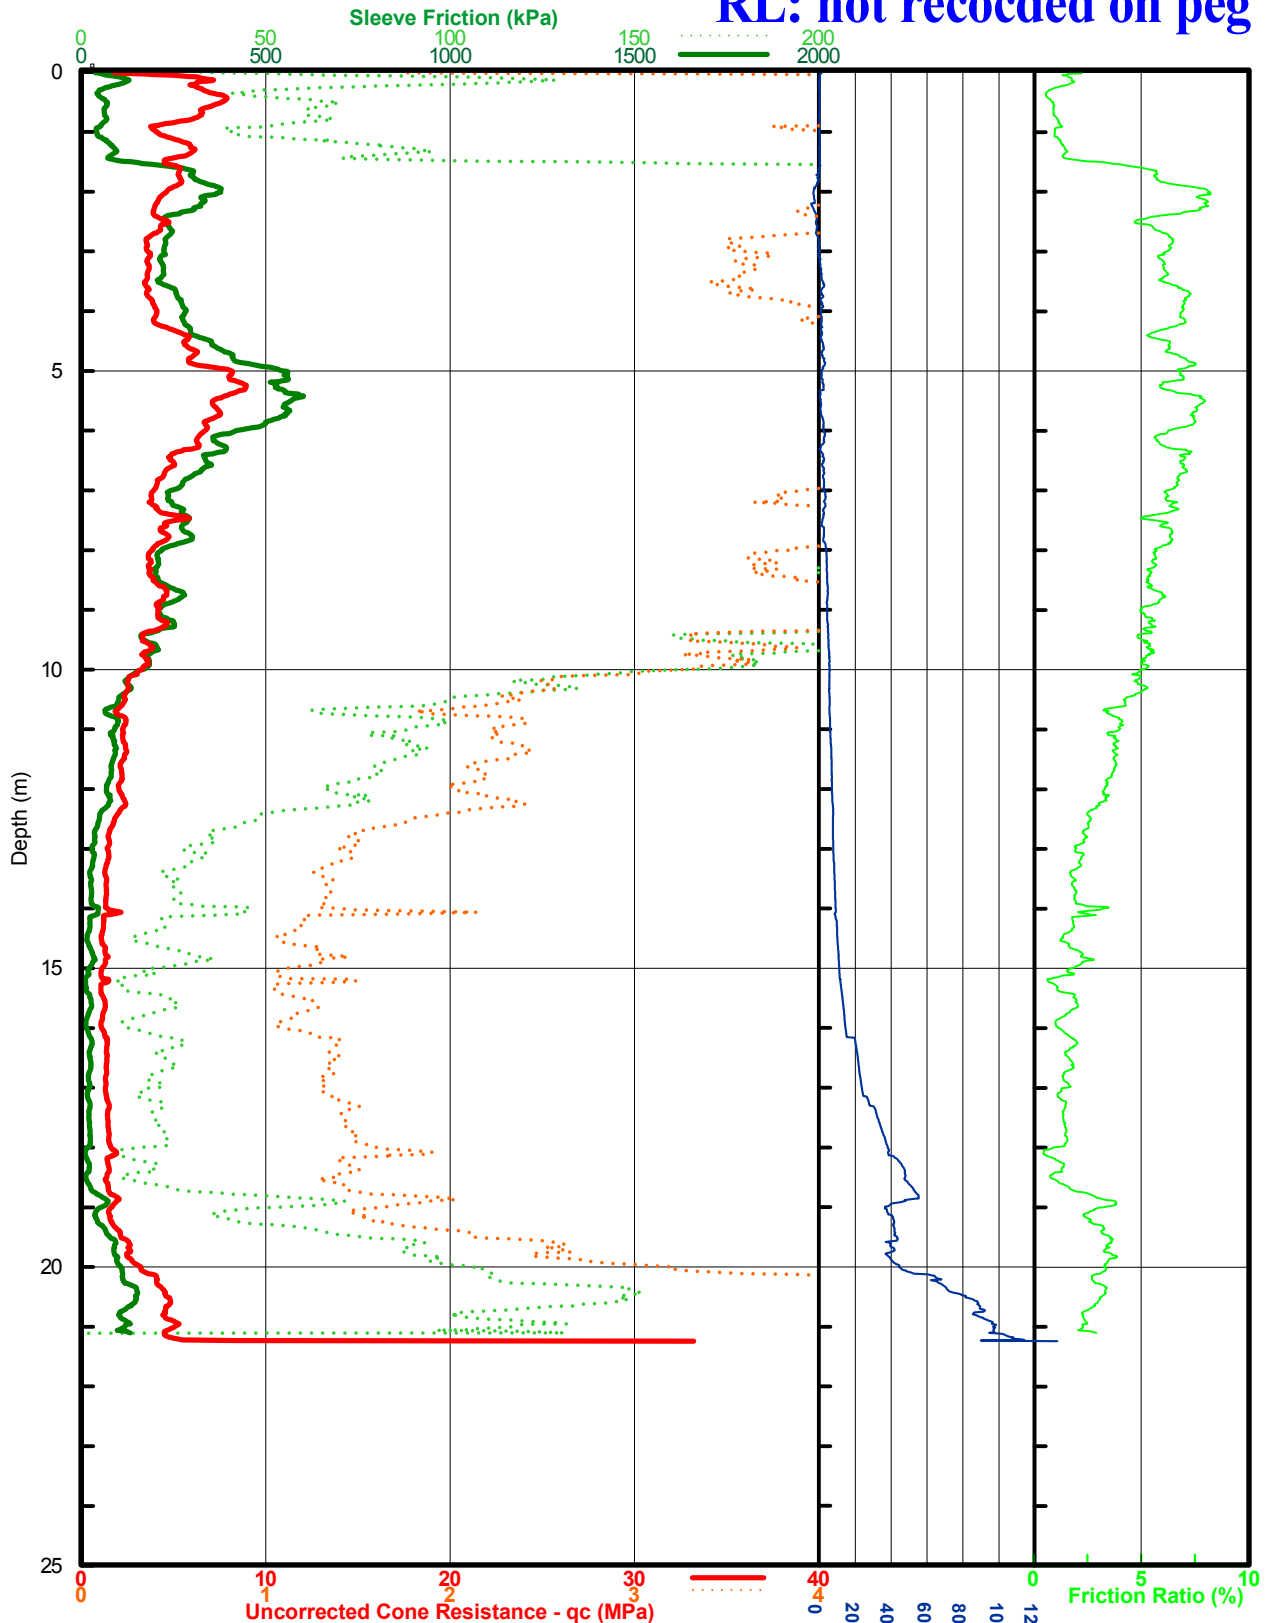

Job Number : G19-02-01
Test Date : 19/02/2019
GPS Position : 56 J 0494708, 6954908
GPS Format : WGS 84
Rig : Esme
Cone Number : C15CFIIP.C15178
Predrill Depth : 0.00m
Dissipation Tests @ : N/A
Terminated Due To : Equipment at Risk

Tested By : Sergey Skrobotov
Test Category : IGS-1C
Checked By : Dean Treloar

Insitu
Geotech
Services
Pty Ltd


IGS

CONE PENETROMETER TEST RESULT

TMR
Centenary Bridge Upgrade
Jindalee QLD

CPT7a

RL: not recorded on peg

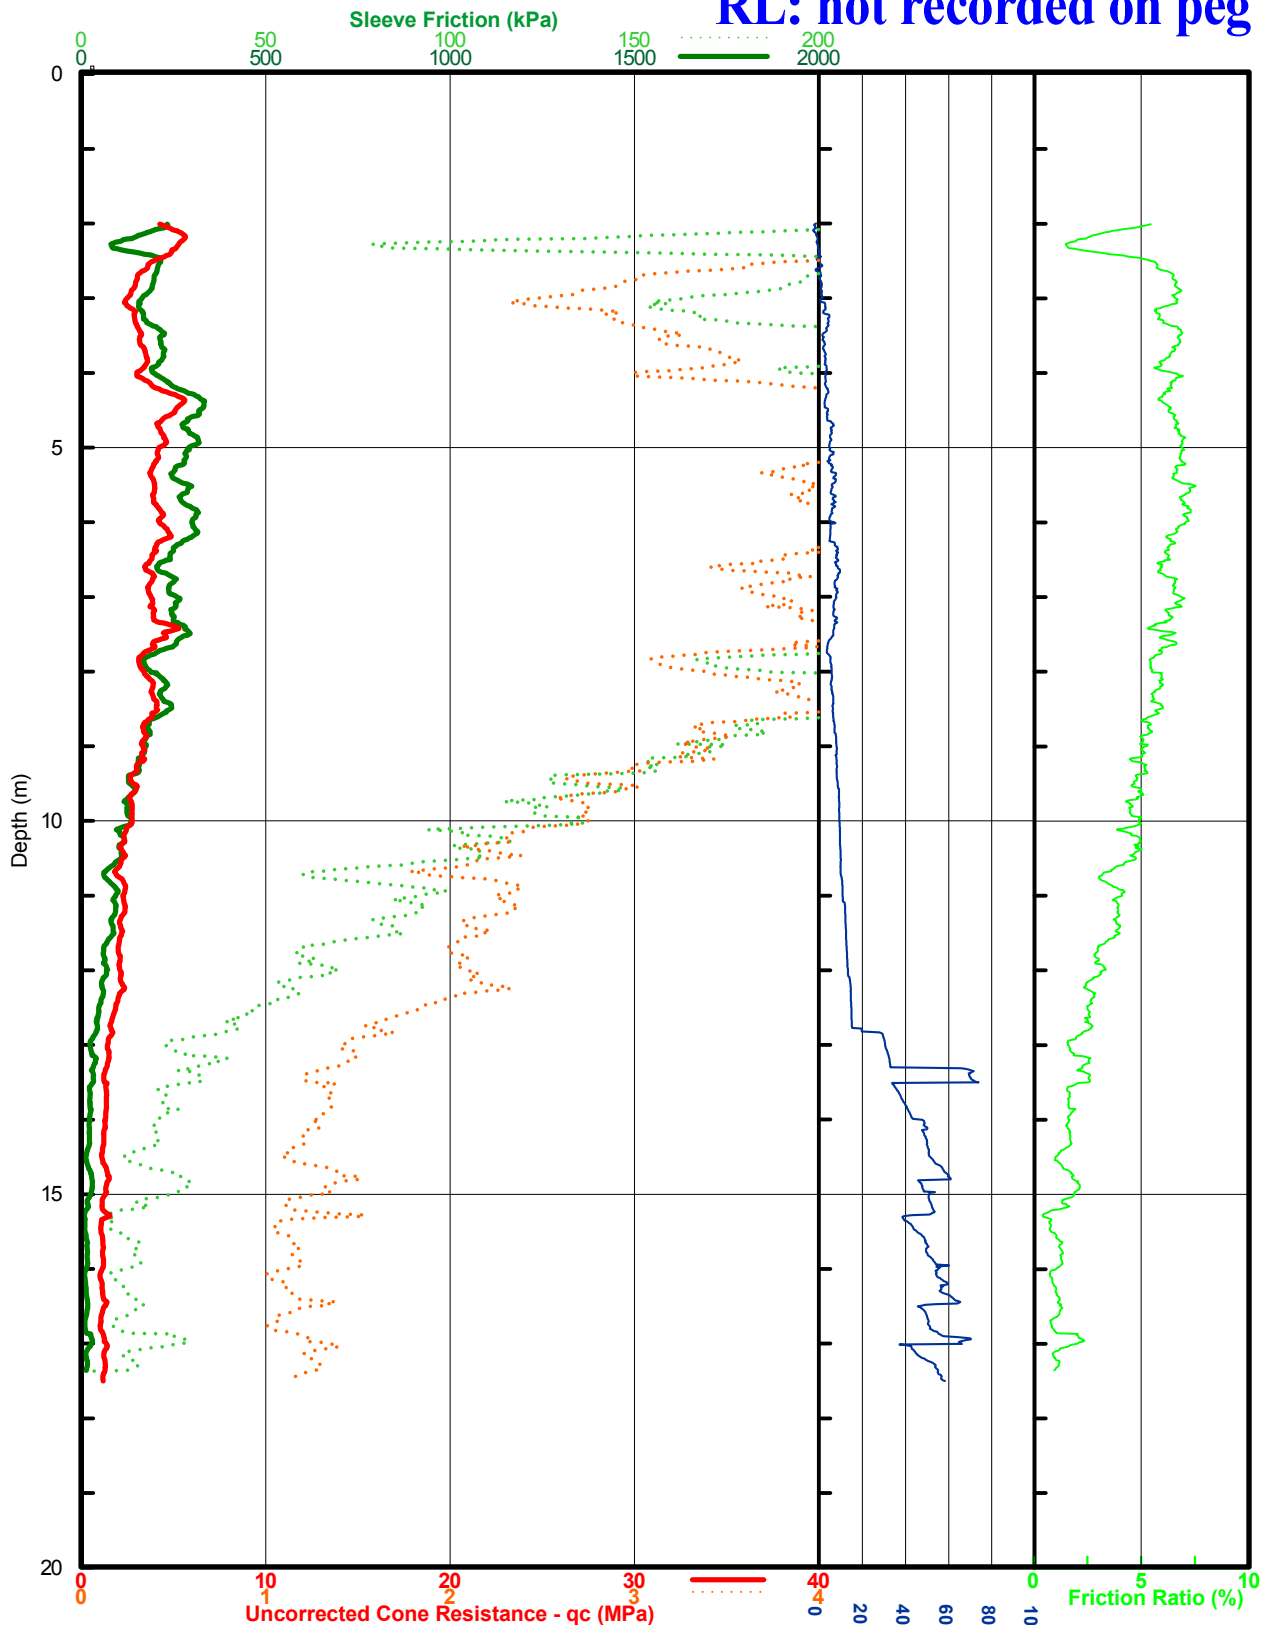

Job Number : G19-02-01
Test Date : 19/02/2019
GPS Position : 56 J 0494708, 6954908
GPS Format : WGS 84
Rig : Esme
Cone Number : C15CFIIP.C15178
Predrill Depth : 2.00m
Dissipation Tests @ : 13.5m 17m
Terminated Due To : Required Depth Reached

Tested By : Sergey Skrobotov
Test Category : IGS-3C
Checked By : Dean Treloar


Insitu
Geotech
Services
Pty Ltd

IGS

PORE PRESSURE DISSIPATION TEST RESULT

TMR
Centenary Bridge Upgrade
Jindalee QLD

CPT7
Depth: 13.5m

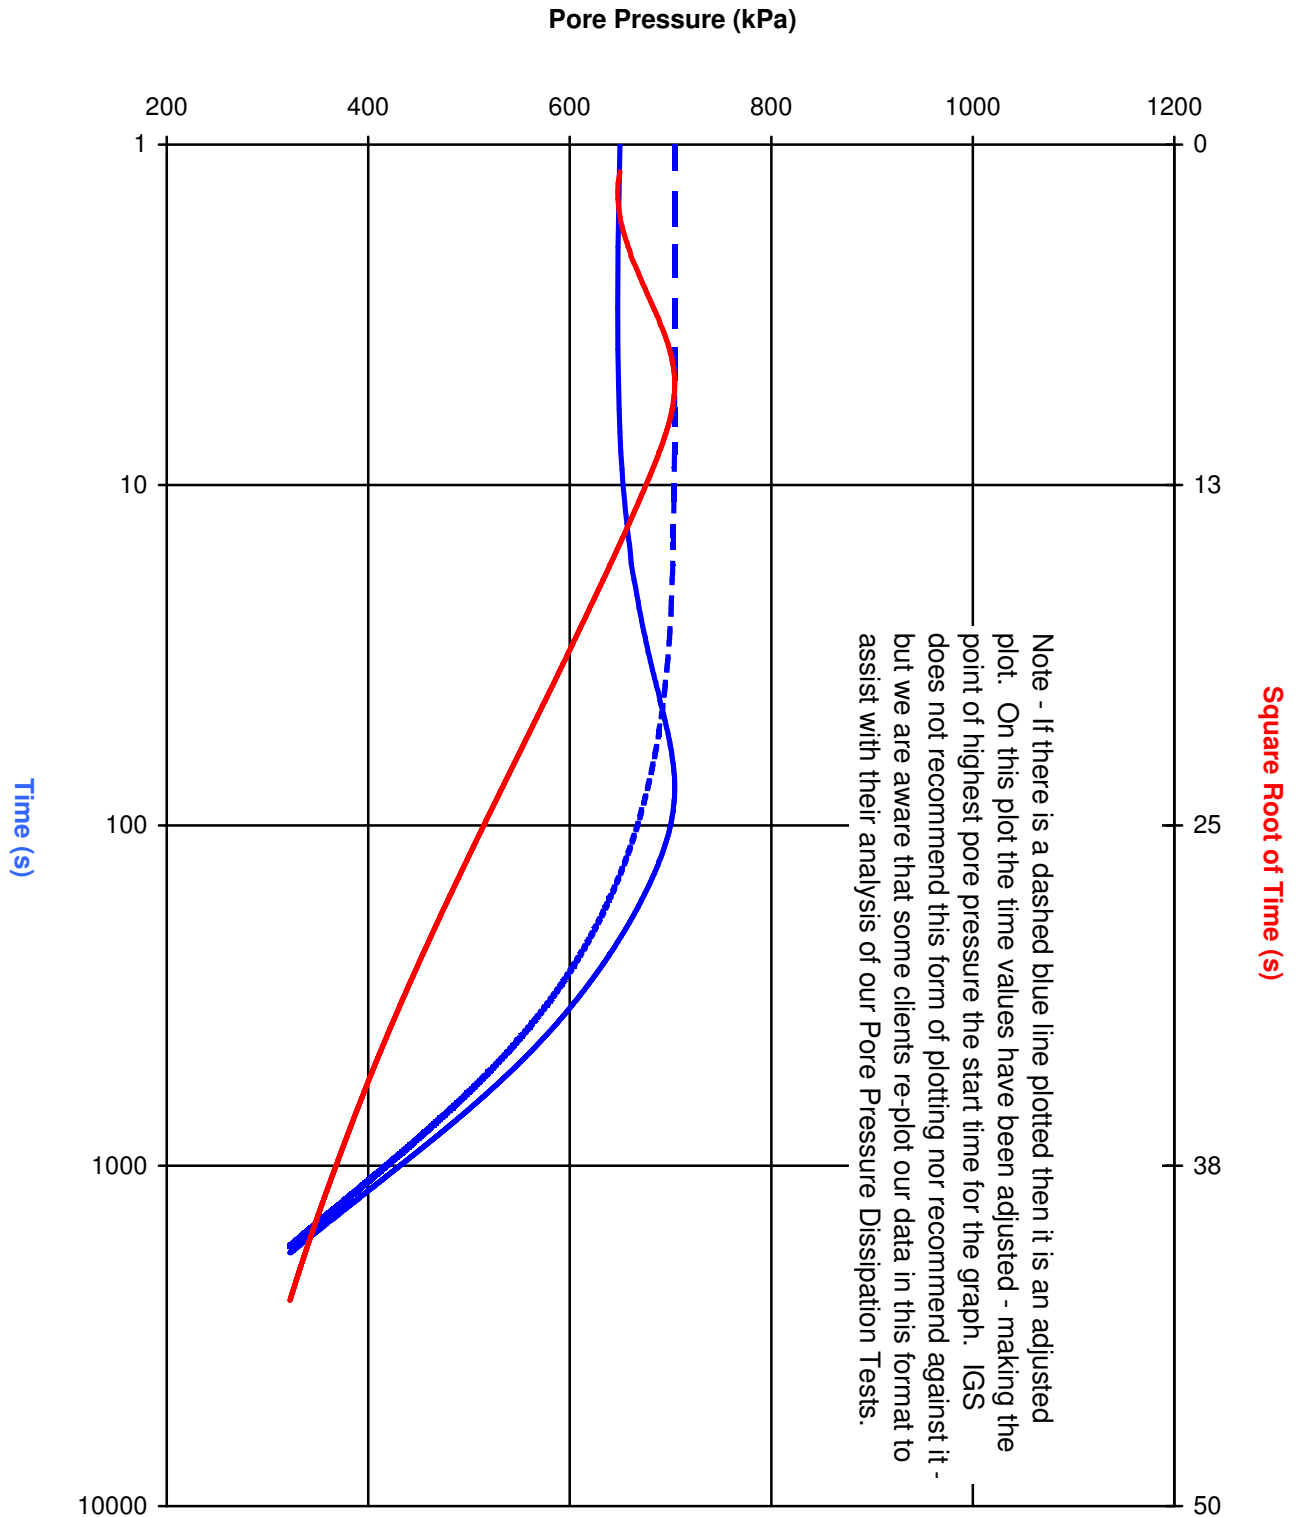


Tested By: Sergey Skrobotov
Test Duration: 0 Hours, 30 Minutes
Test Date: 19/02/2019
Job No: G19-02-01
Cone: C15CFIIP.C15178



PORE PRESSURE DISSIPATION TEST RESULT

TMR
Centenary Bridge Upgrade
Jindalee QLD

CPT7
Depth: 17m

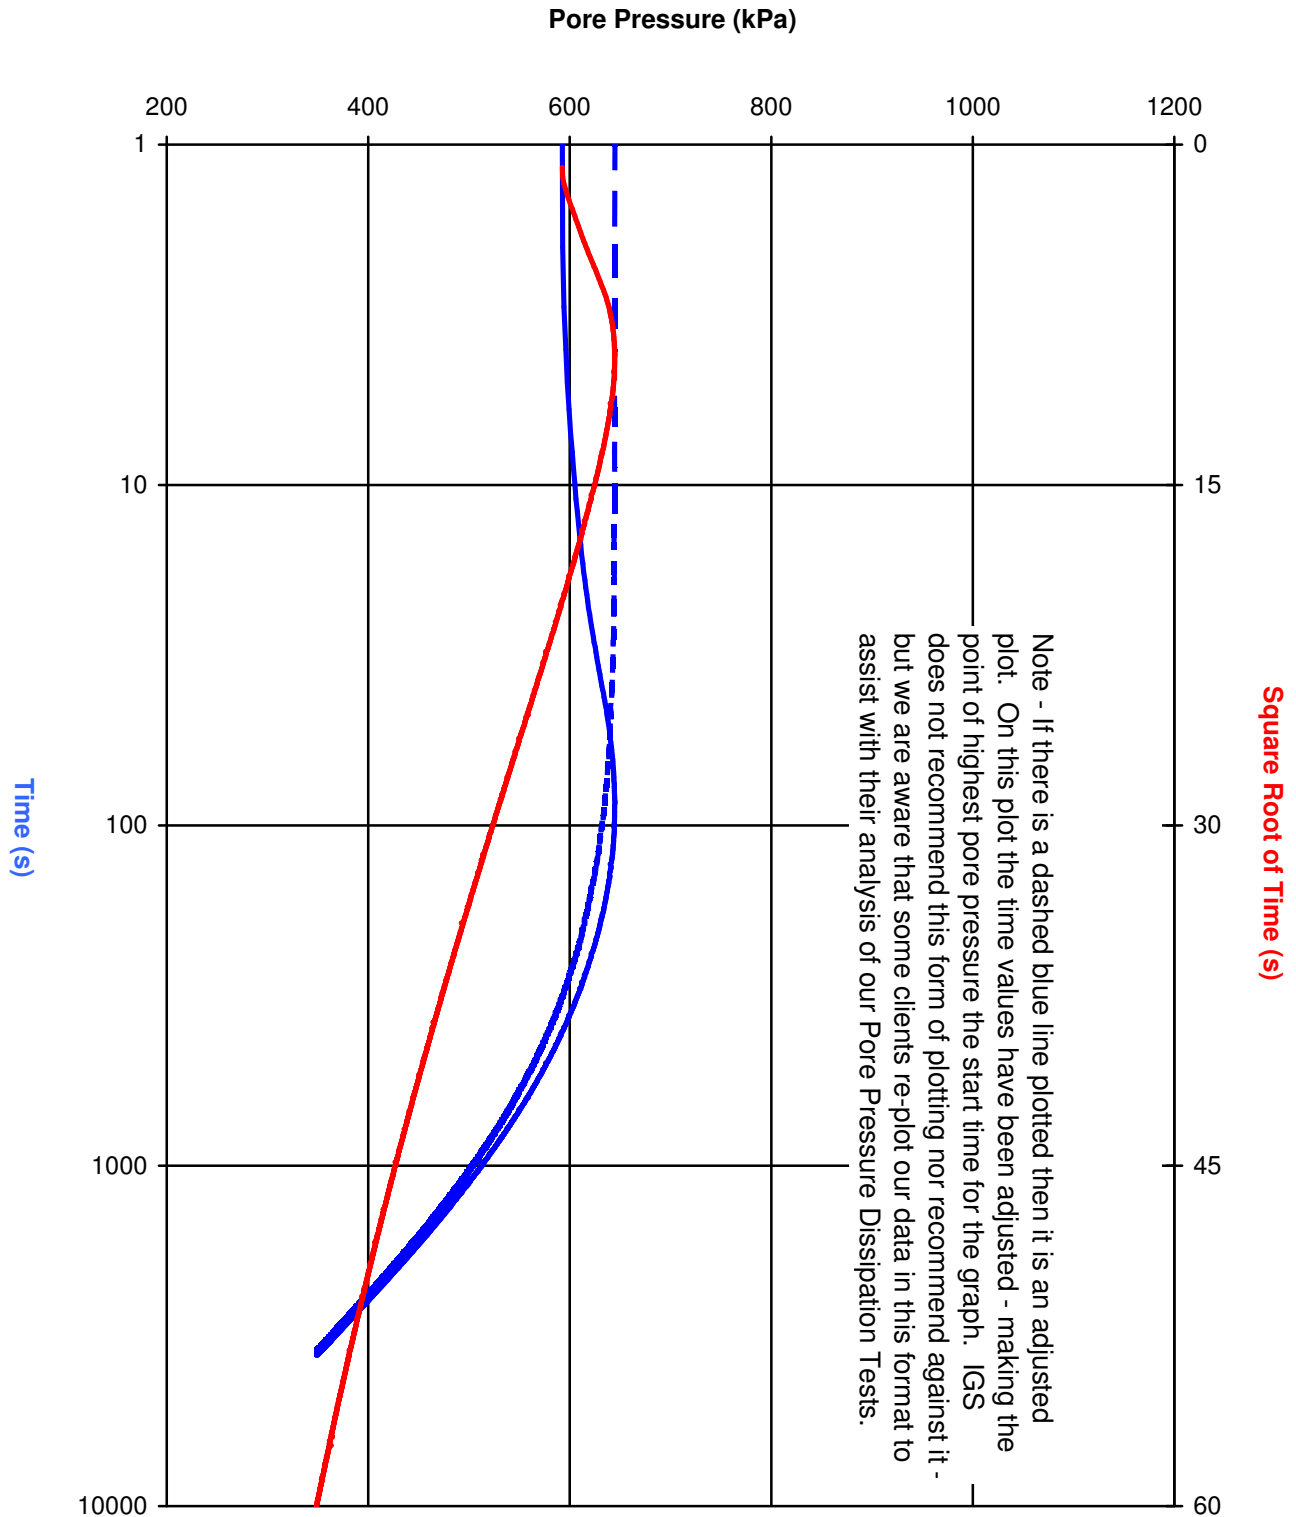

Tested By: Sergey Skrobotov
Test Duration: 1 Hours, 0 Minutes
Test Date: 19/02/2019
Job No: G19-02-01
Cone: C15CFIIP.C15178



VANE SHEAR TEST RESULT


TMR

Centenary Bridge Upgrade

Jindalee QLD

CPT7

14m

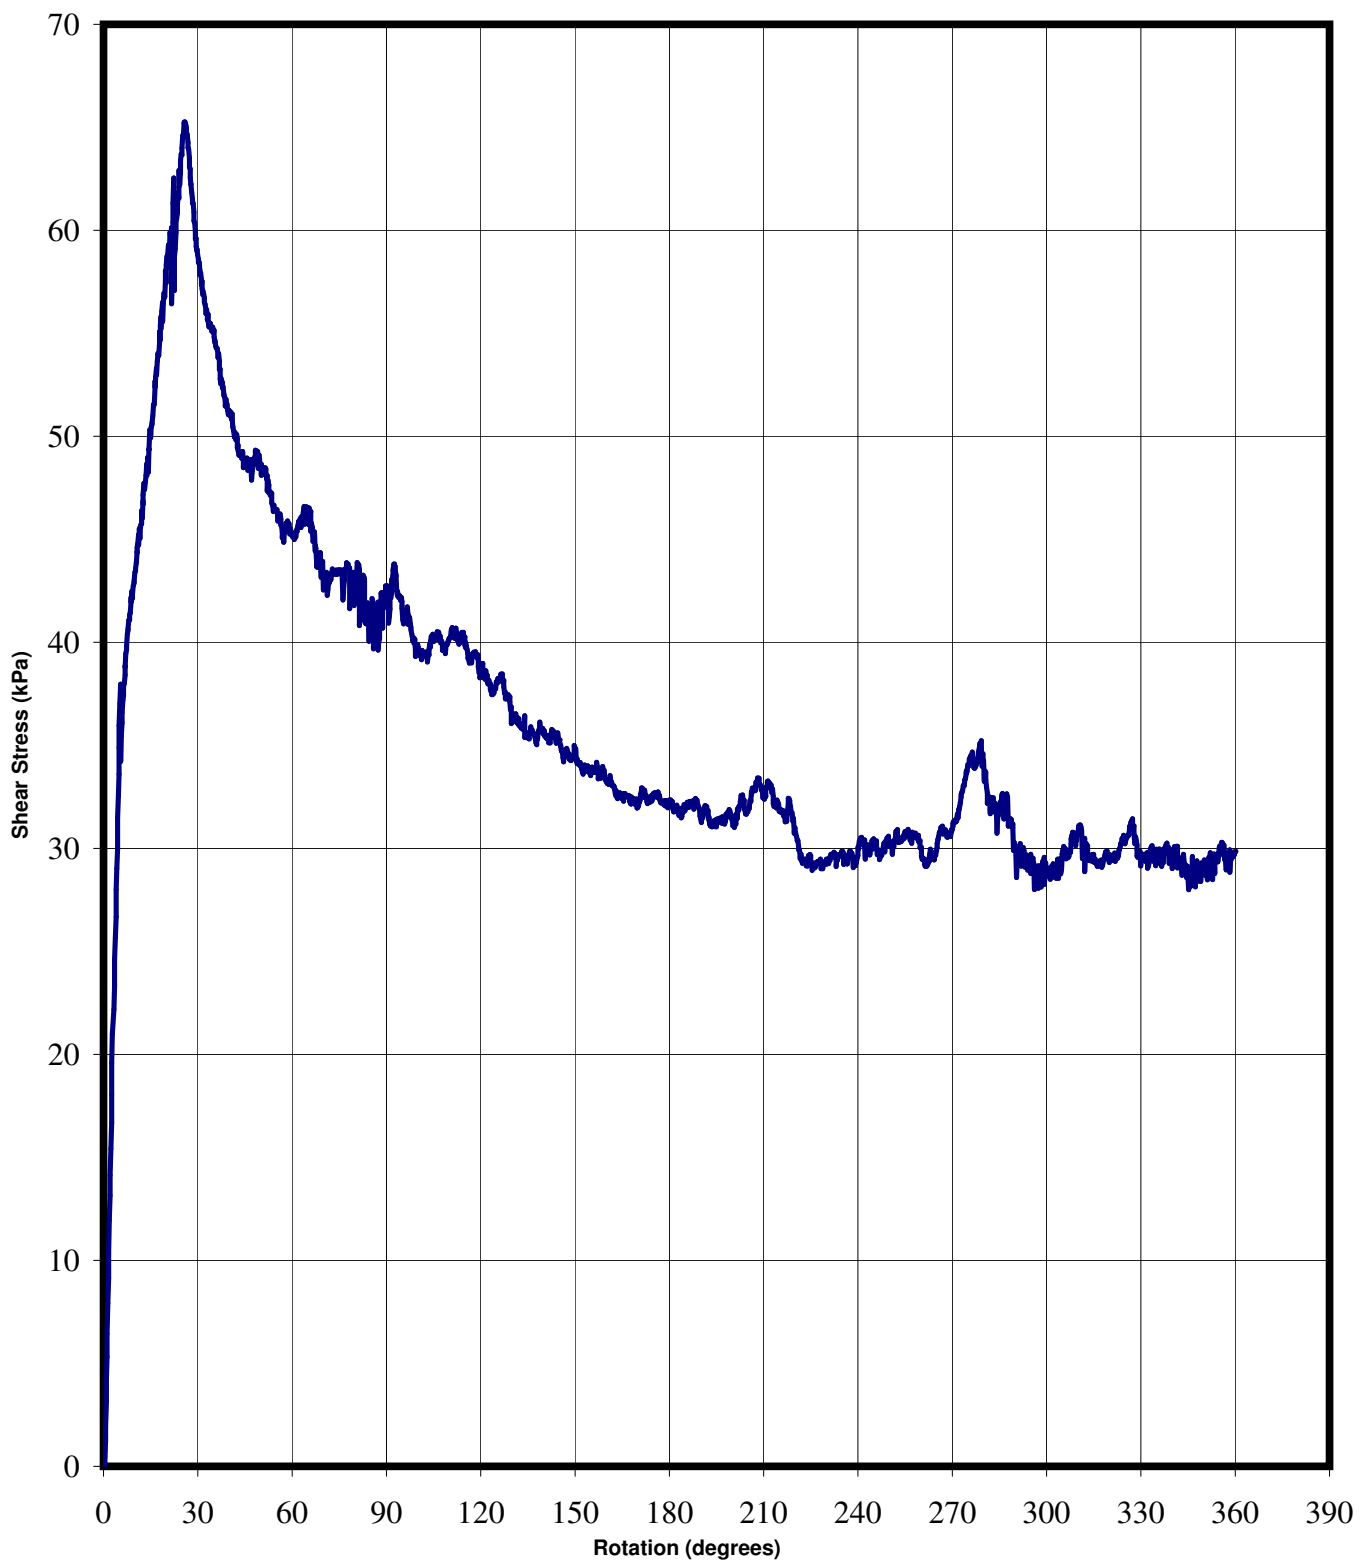

Note: This test takes into account rod friction along the thin connecting rod immediately above the vane.
See www.insitu.com.au for our testing procedure.

Tested By: Sergey Skrobotov

Test Date: 19/02/2019

Job Number: G19-02-01

DGPS Position: 56 J 0494708, 6954908



VANE SHEAR TEST RESULT


TMR

Centenary Bridge Upgrade

Jindalee QLD

CPT7

16m

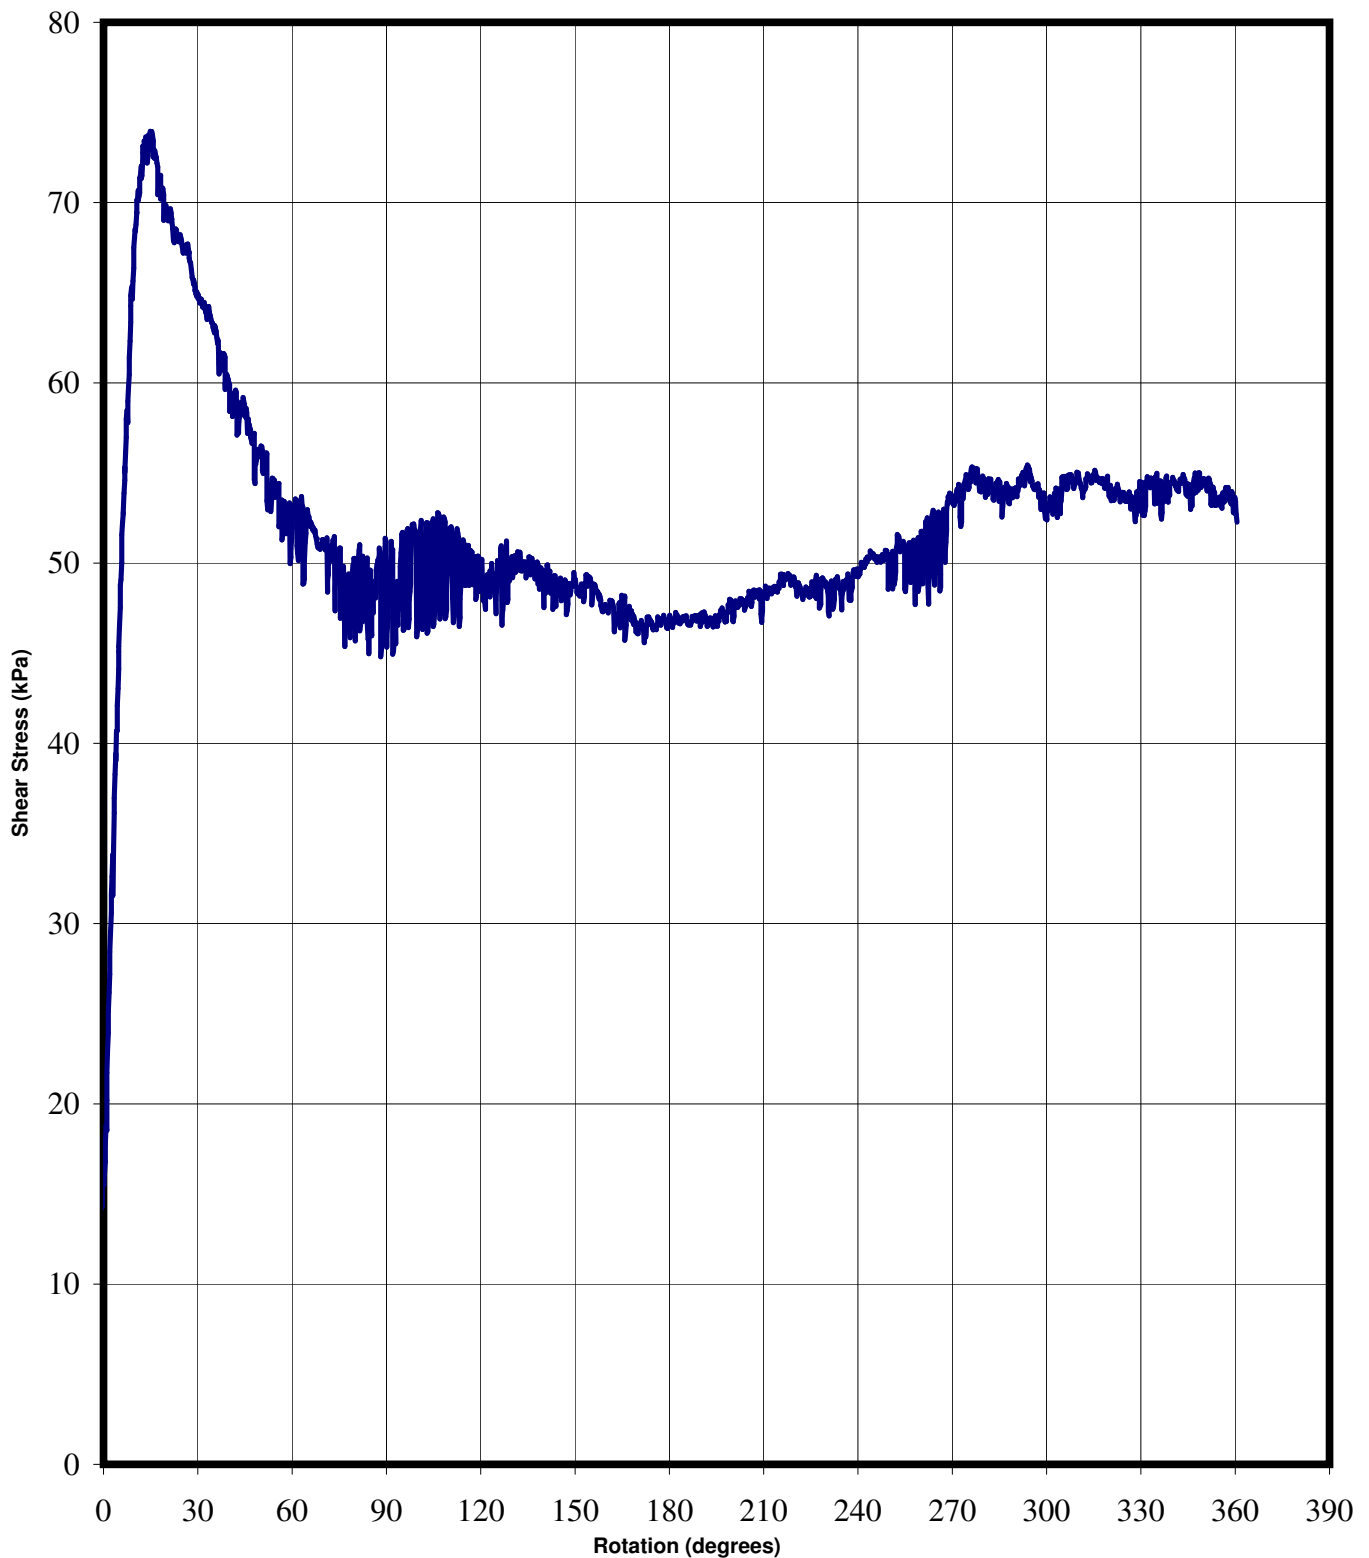

Note: This test takes into account rod friction along the thin connecting rod immediately above the vane.
See www.insitu.com.au for our testing procedure.

Tested By: Sergey Skrobotov
Test Date: 20/02/2019
Job Number: G19-02-01
DGPS Position: 56 J 0494708, 6954908

