

COPYRIGHT NOTICE

This geotechnical log and its associated data (the Document) is licensed by the Queensland Department of Transport and Main Roads under the [Creative Commons Attribution 4.0 Licence](#) (CC BY 4.0). When reusing the Document, in whole or in part, please attribute the Department and author as follows: "(c) *State of Queensland (Department of Transport and Main Roads) 2026, licensed under the CC BY 4.0 Licence, prepared by Insitu Geotech Services*". This licence does not apply to logos or trademarks.

LIMITATION OF LIABILITY

The CC BY 4.0 Licence contains a comprehensive Disclaimer of Warranties and Limitation of Liability. In addition, please note that this Document was prepared for Departmental use only. Reuse of the Document by anyone for any other purpose could result in error and/or loss. You should obtain professional advice before making decisions based on the contents of the Document.


When reproducing any part of this Document, you must also reproduce this limitation of liability notice in addition to the italicised attribution statement above.

Retrieved from the Queensland Geotechnical Database <http://qgd.org.au/>

CONE PENETROMETER TEST RESULT

TMR
Centenary Bridge Upgrade
Jindalee QLD

CPT1
RL: 8.70m

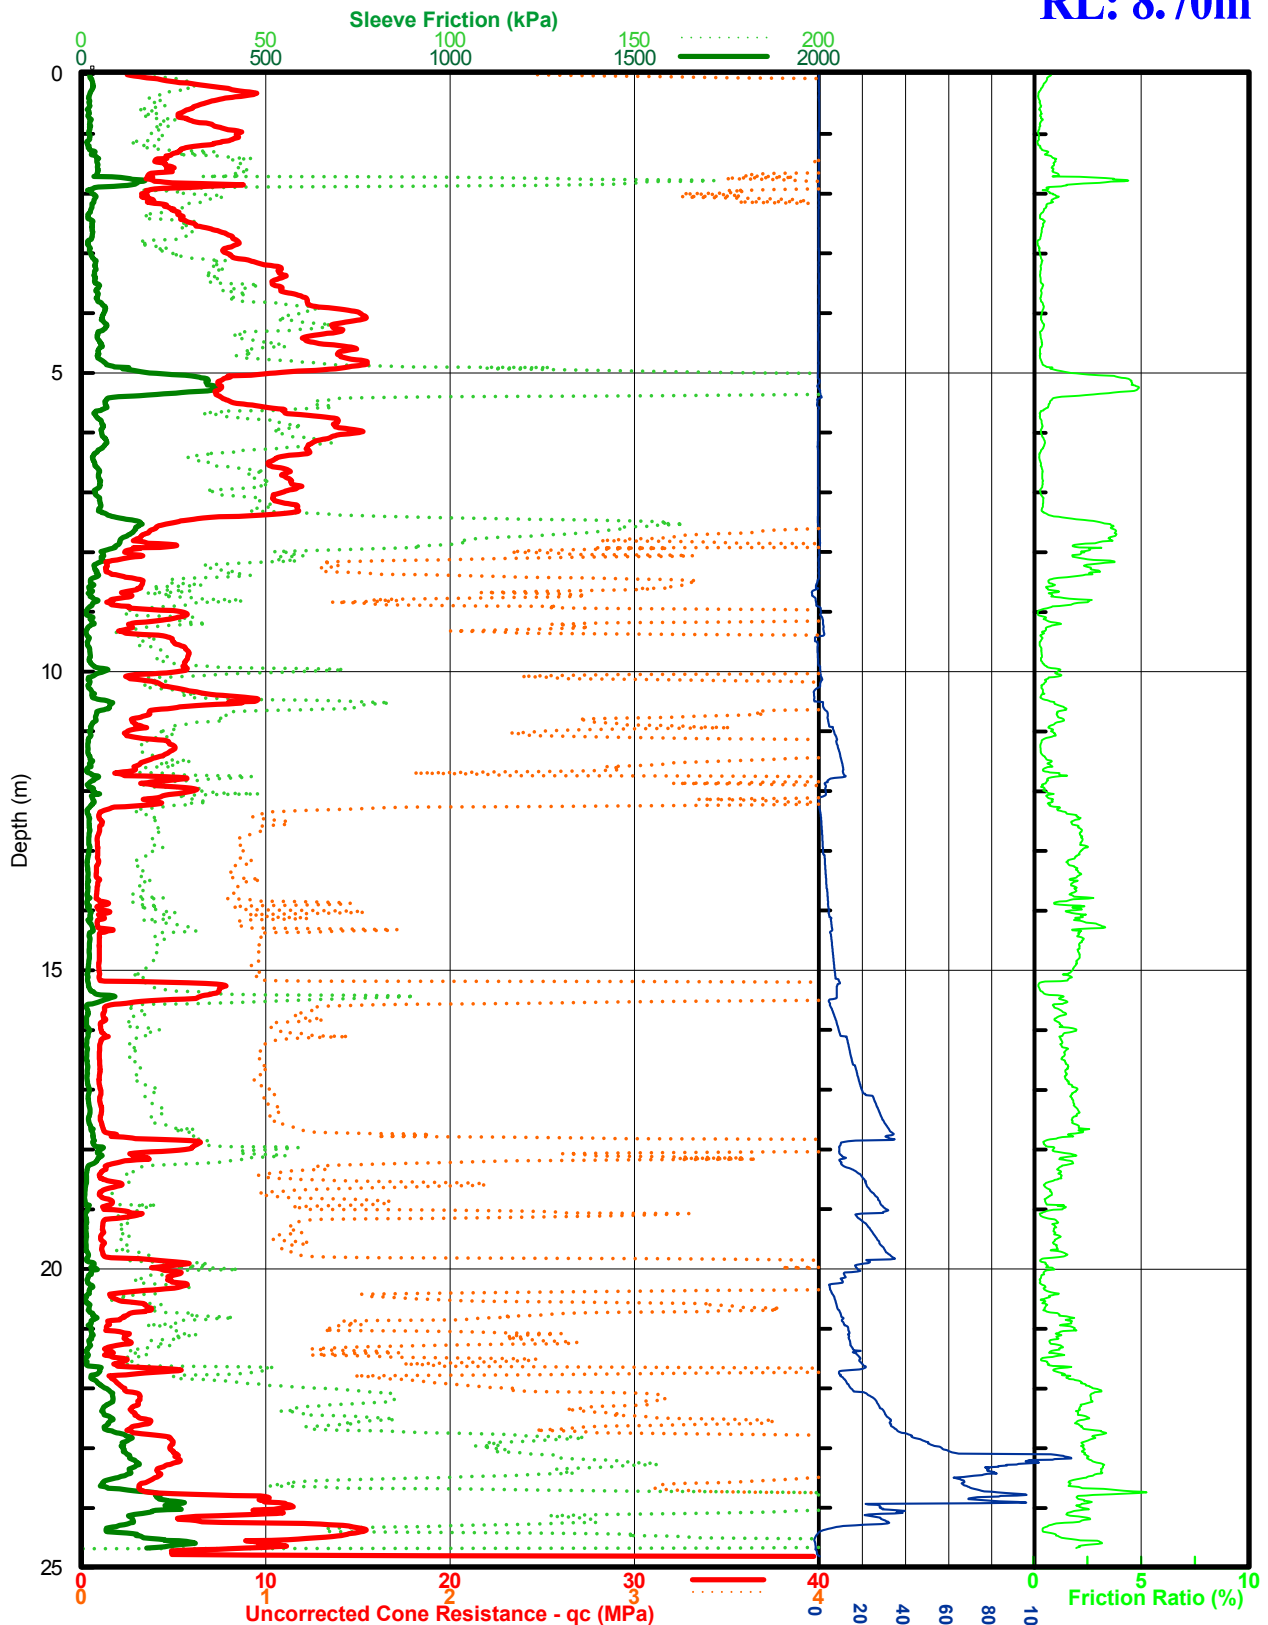

Job Number : G19-02-01
Test Date : 11/02/2019
GPS Position : 56 J 0494708, 6955012
GPS Format : WGS 84
Rig : Esme
Cone Number : C10CFIIP.C18143
Predrill Depth : 0.00m
Dissipation Tests @ : N/A
Terminated Due To : Equipment at Risk

Tested By : Ryan Currall
Test Category : IGS-1C
Checked By : Dean Treloar


Insitu
Geotech
Services
Pty Ltd

IGS

CONE PENETROMETER TEST RESULT

TMR
Centenary Bridge Upgrade
Jindalee QLD

CPT1a
RL: 8.70m

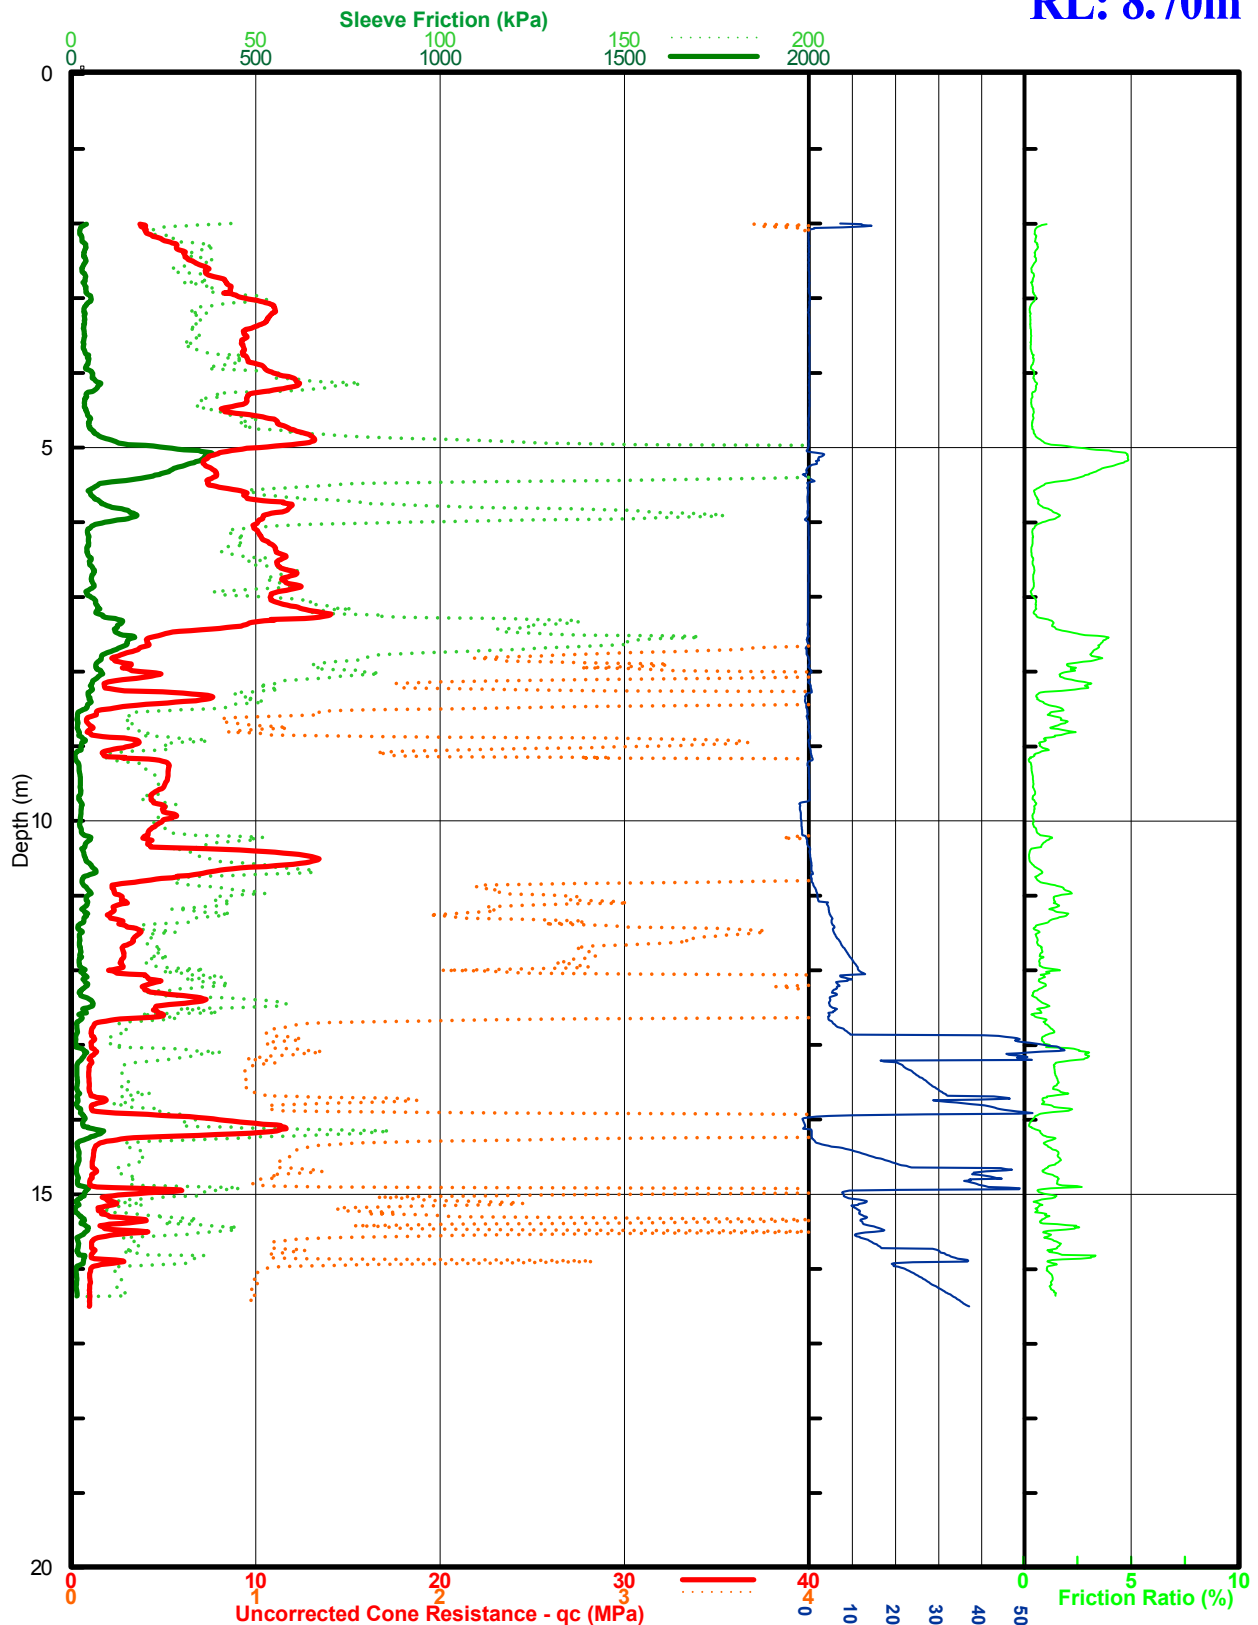

Job Number : G19-02-01
Test Date : 11/02/2019
GPS Position : 56 J 0494708, 6955012
GPS Format : WGS 84
Rig : Esme
Cone Number : C10CFIIP.C18143
Predrill Depth : 2.00m
Dissipation Tests @ : 13.2m 16.5m
Terminated Due To : Required Depth Reached

Tested By : Ryan Currall
Test Category : IGS-3C
Checked By : Dean Treloar


Insitu
Geotech
Services
Pty Ltd

IGS

PORE PRESSURE DISSIPATION TEST RESULT

TMR
Centenary Bridge Upgrade
Jindalee QLD

CPT1a
Depth: 13.2m

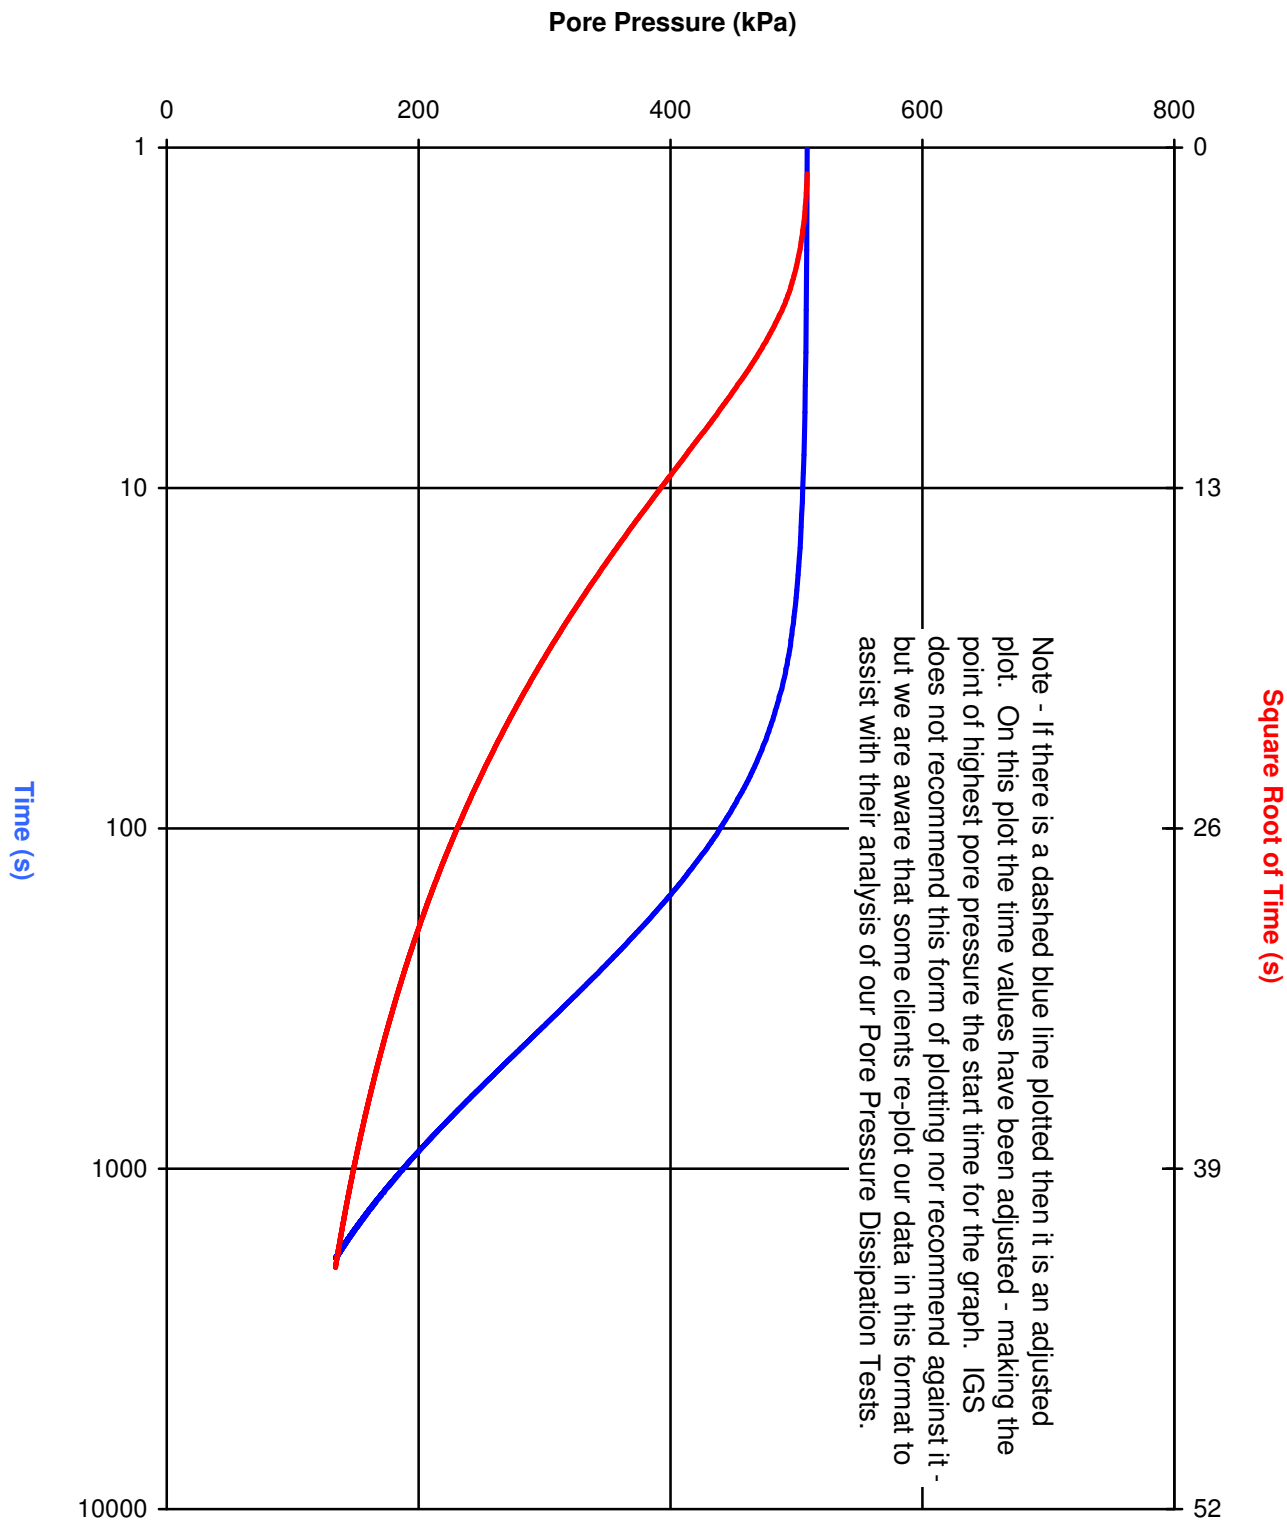


Tested By: Ryan Currall
Test Duration: 0 Hours, 30 Minutes
Test Date: 11/02/2019
Job No: G19-02-01
Cone: C10CFIIP.C18143



PORE PRESSURE DISSIPATION TEST RESULT

TMR
Centenary Bridge Upgrade
Jindalee QLD

CPT1a
Depth: 16.5m

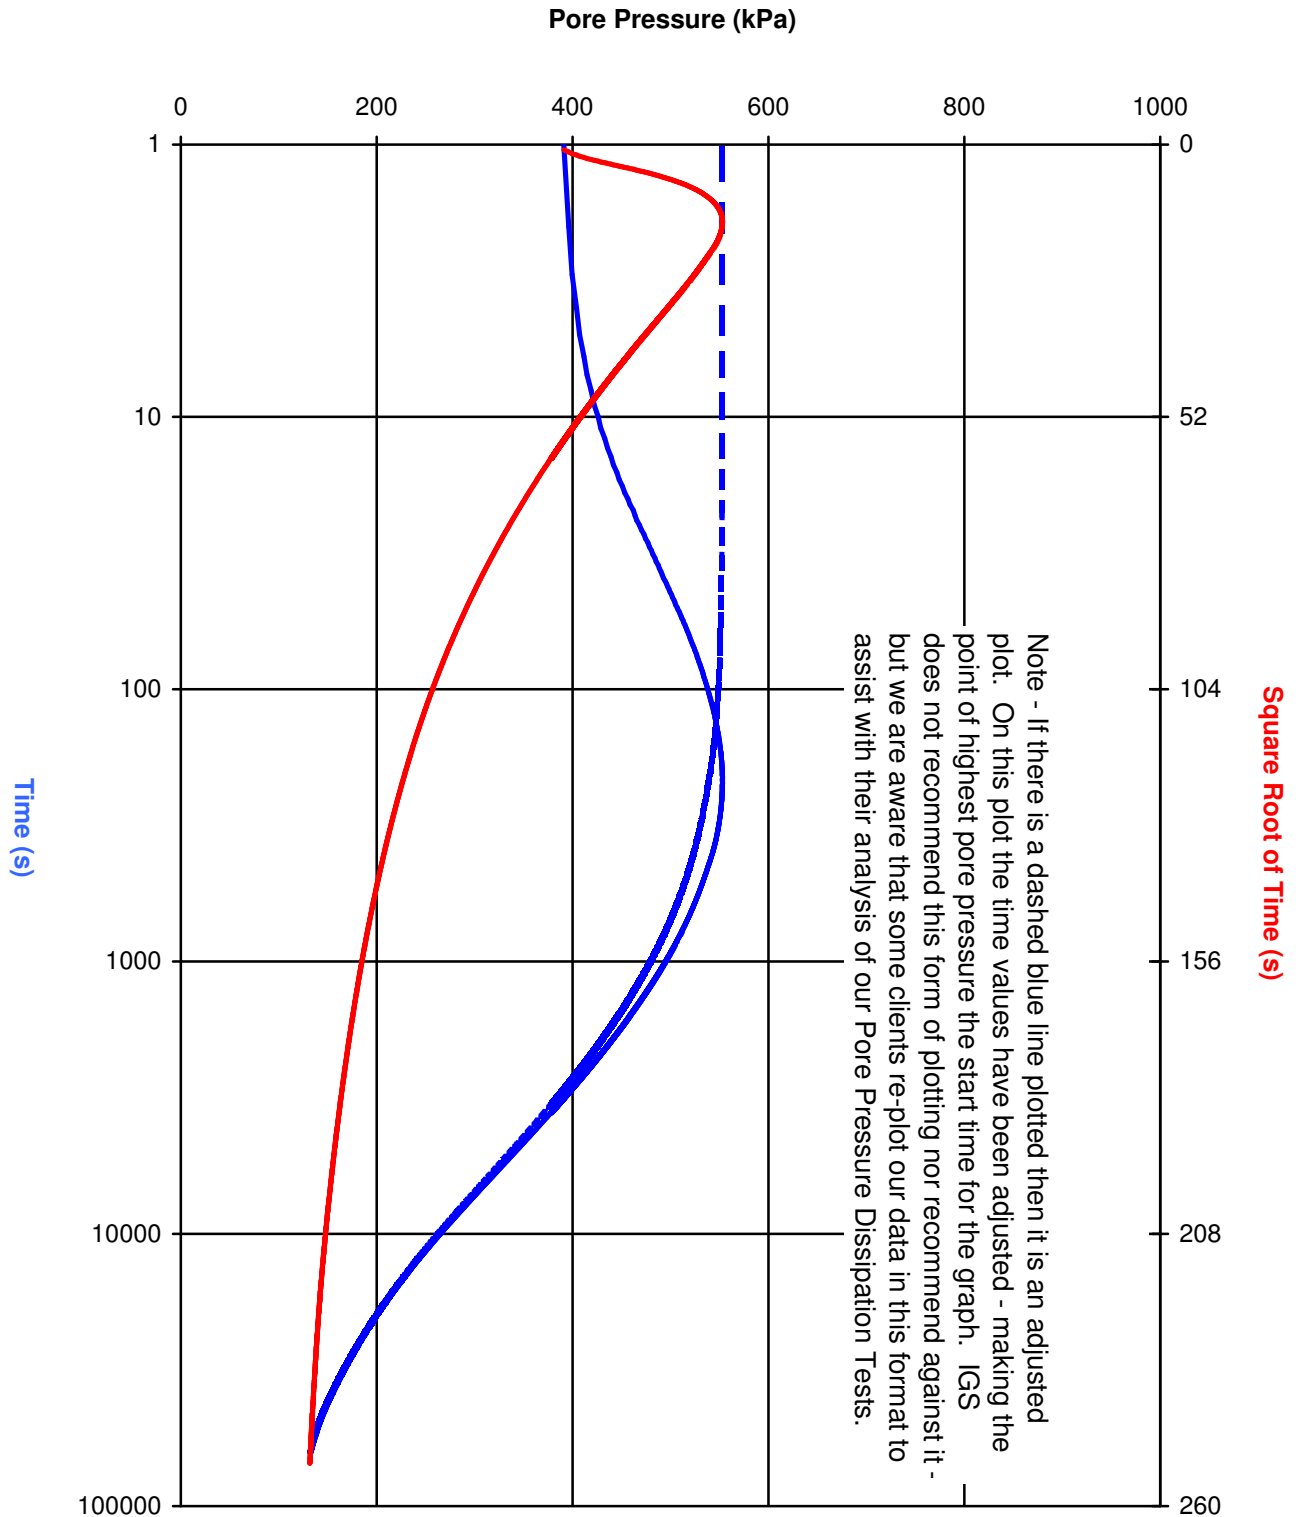

Tested By: Ryan Currall
Test Duration: 17 Hours, 37 Minutes
Test Date: 11/02/2019
Job No: G19-02-01
Cone: C10CFIIP.C18143



VANE SHEAR TEST RESULT


TMR

Centenary Bridge Upgrade

Jindalee QLD

CPT1

13.5m

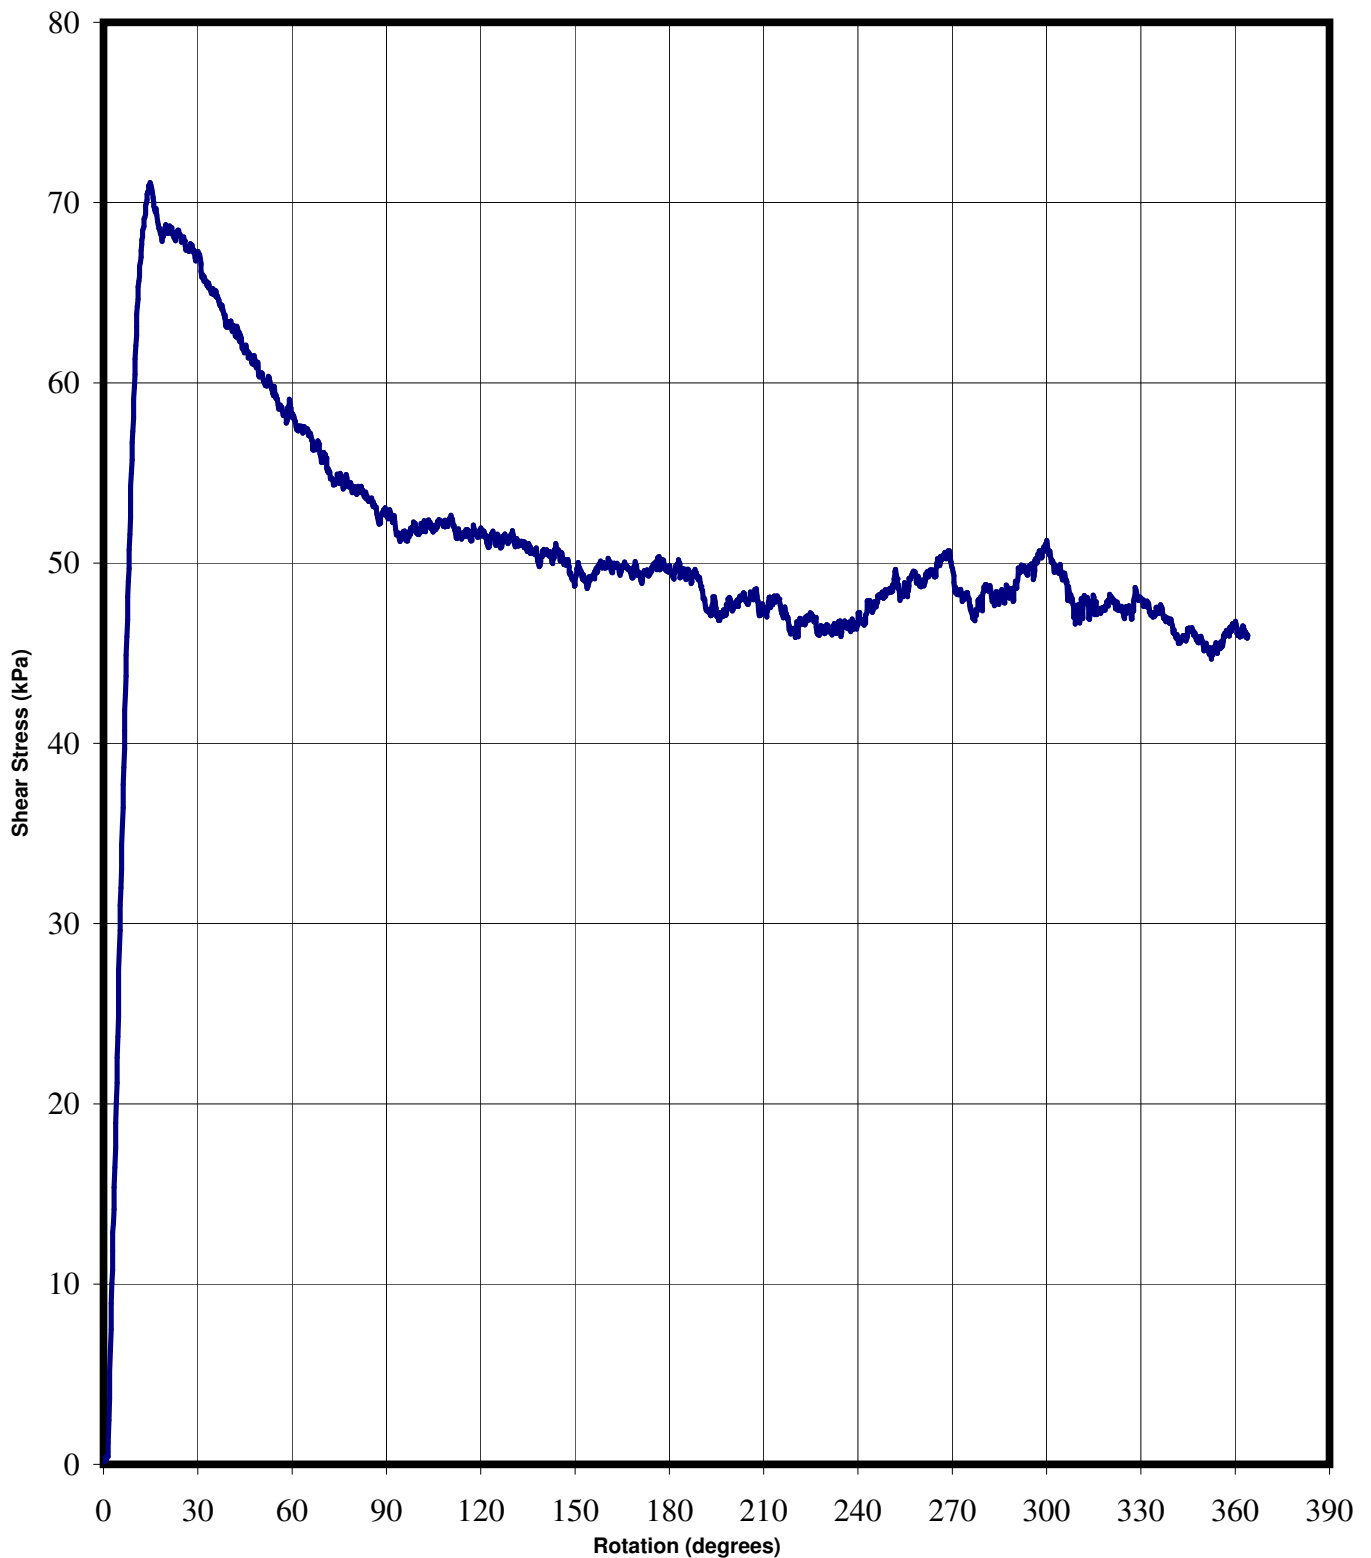

Note: This test takes into account rod friction along the thin connecting rod immediately above the vane.
See www.insitu.com.au for our testing procedure.

Tested By: Ryan Currall
Test Date: 12/02/2019
Job Number: G19-02-01
DGPS Position: 56 J 0494708, 6955012



VANE SHEAR TEST RESULT


TMR

Centenary Bridge Upgrade

Jindalee QLD

CPT1

16.5m

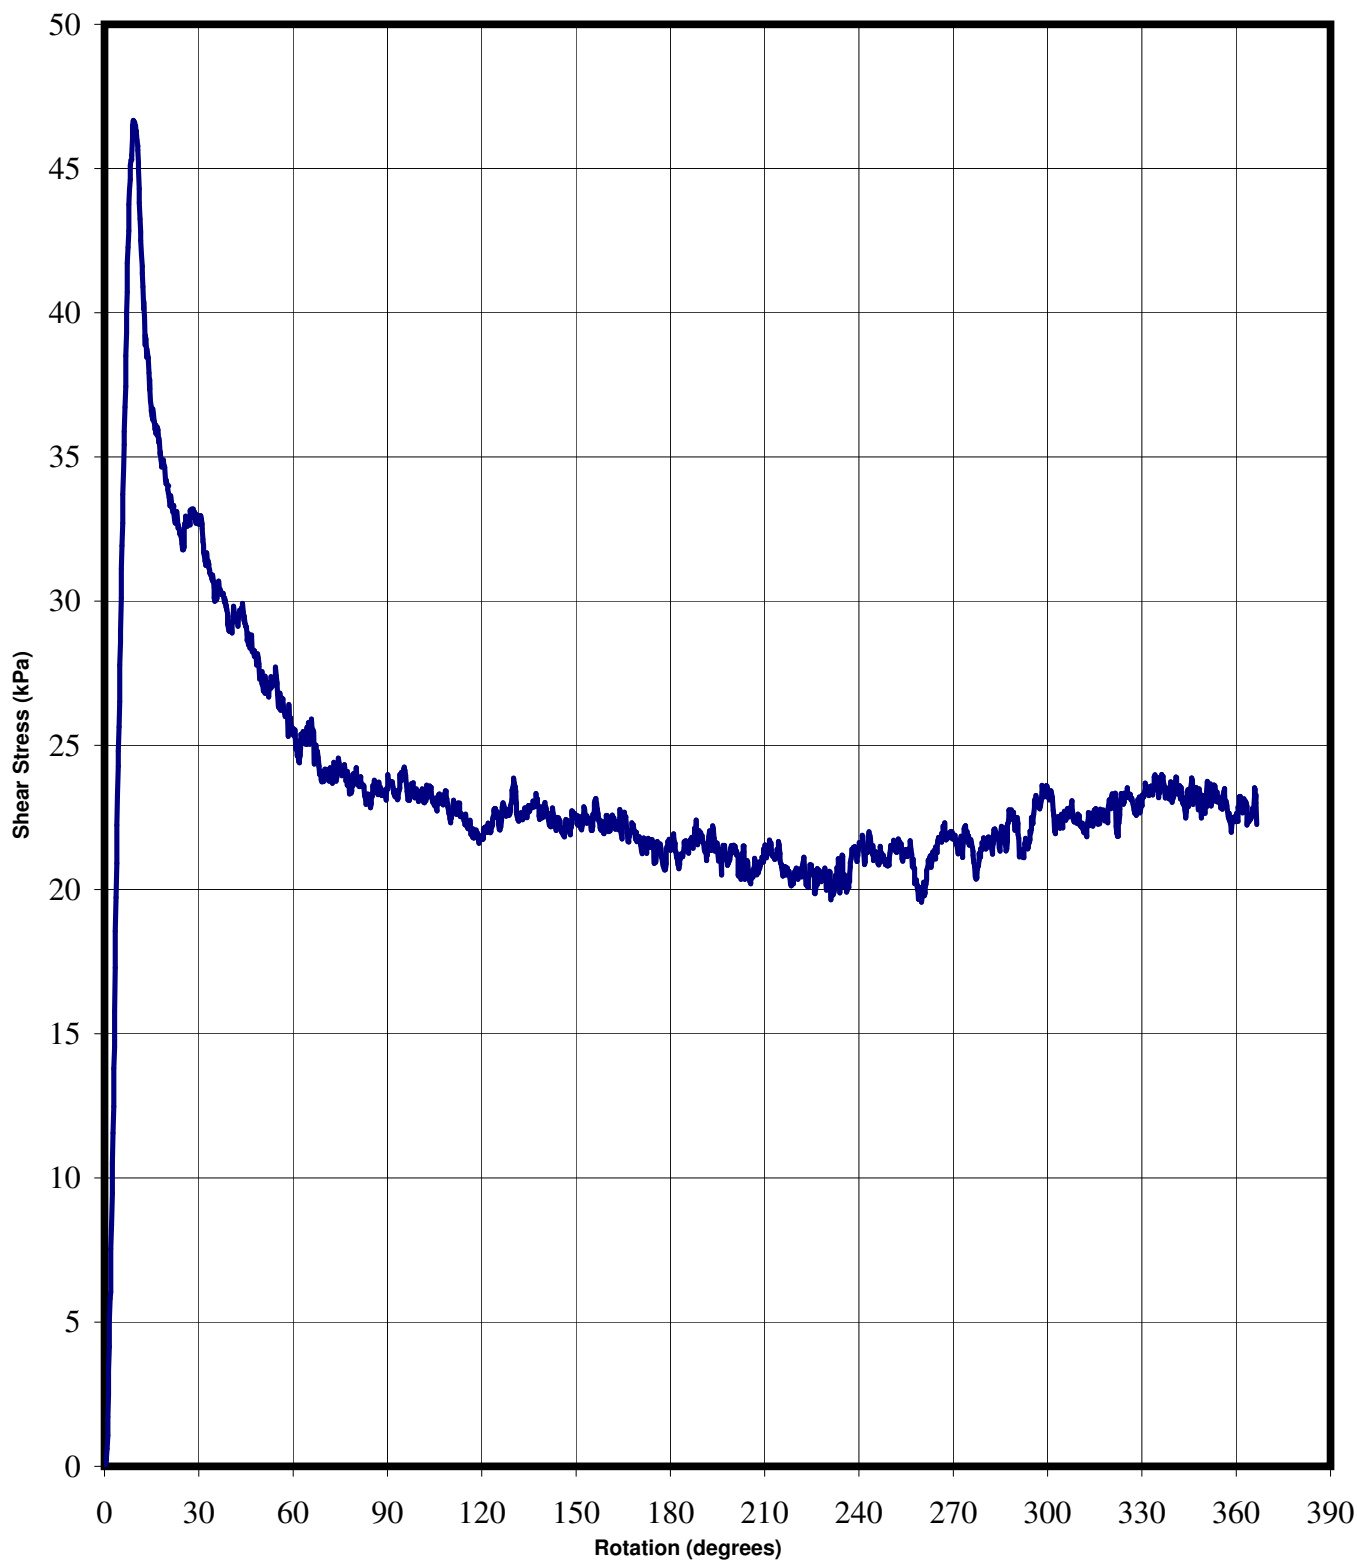

Note: This test takes into account rod friction along the thin connecting rod immediately above the vane.
See www.insitu.com.au for our testing procedure.

Tested By: Ryan Currall
Test Date: 12/02/2019
Job Number: G19-02-01
DGPS Position: 56 J 0494708, 6955012

